



Ford C-MAX Standard Safety Equipment





Adult Occupant		Child Occupant			
	76%	Ľ	60%		
Pedestrian		Safety Assist			
え	59%	I D))	29%		

SPECIFICATION

Tested Model	Ford Grand C-MAX 1.5 diesel 'Titanium', LHD
Body Type	- 5 door MPV
Year Of Publication	2017
Kerb Weight	1606kg
VIN From Which Rating Applies	- WF0WXXGCEWHE77742
Class	Small MPV

General comments

The Ford Grand C-MAX and the Ford Compact C-MAX are identical apart from the way the rear doors operate. Euro NCAP tested the heavier Grand C-MAX and the results of those tests are used in this assessment.



SAFETY EQUIPMENT

	Driver	Passenger	Rear
FRONTAL CRASH PROTECTION			
Frontal airbag	٠	•	×
Belt pretensioner	•	•	×
Belt loadlimiter	•	•	×
Knee airbag	×	×	×
SIDE CRASH PROTECTION			
Side head airbag	٠	•	•
Side chest airbag	٠	•	×
Side pelvis airbag	٠	•	×
CHILD PROTECTION			
Isofix	—	×	٠
Integrated CRS	—	×	×
Airbag cut-off switch		0	_
SAFETY ASSIST			
Seat Belt Reminder	٠	•	×

OTHER SYSTEMS	
Active Bonnet (Hood)	×
AEB Pedestrian	×
AEB City	•
AEB Inter-Urban	0
Speed Assistance System	•
Lane Assist System	0

Note: Other equipment may be available on the vehicle but was not considered in the test year.


Fitted to the vehicle as standard


 \bigcirc Fitted to the vehicle as part of the safety pack

O Not fitted to the test vehicle but available as option or as part of the safety pack

🗙 Not available 🛛 — Not applicable



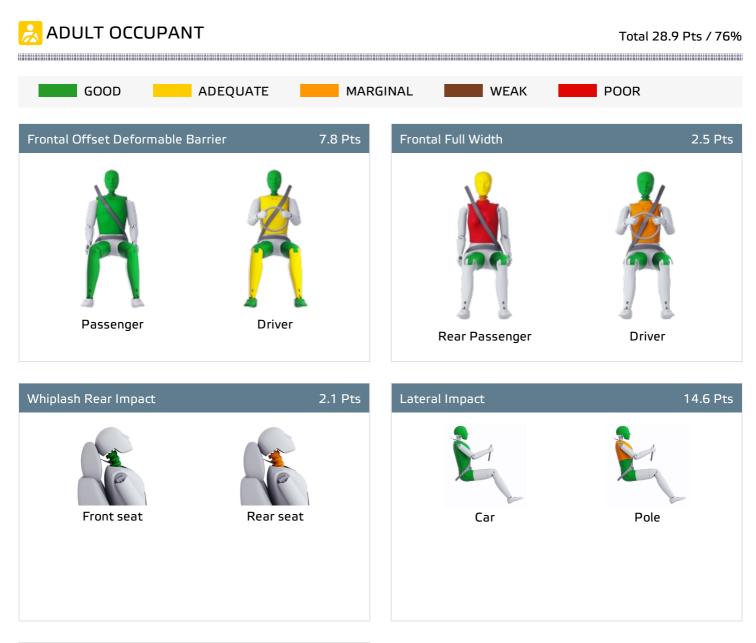

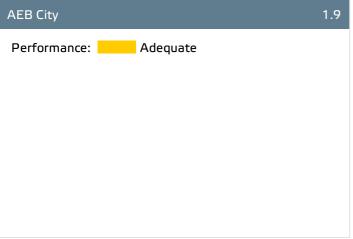

Euro NCAP © Ford C-MAX Dec 2017 3/11



<u> A</u>DULT OCCUPANT

Total 28.9 Pts / 76%

Comments

The passenger compartment of the C-MAX remained stable in the frontal offset test. Dummy readings indicated good protection of the knees and femurs of the driver and passenger. Ford demonstrated that a similar level of protection would be provided to occupants of different sizes and to those sat in different positions. Protection was good for all critical body areas of the passenger dummy in this test. In the full-width rigid barrier test, the pelvis of the driver dummy slipped beneath the lap section of the seatbelt and protection of this area was rated as poor. Dummy readings of chest compression indicated marginal protection. For the rear passenger dummy, a combination of chest compression and high shoulder belt load indicated poor chest protection, and that of the neck was rated as marginal. In the side barrier test, protection of all critical body areas was good and the C-MAX scored maximum points in this test. In the more severe side pole impact, protection of the chest was rated as marginal, based on dummy readings of rib compression. In that test, the sliding door unlatched at the front, creating a gap between the door and the car body, and the score was penalised for this. Tests on the front seats and head restraints demonstrated good protection. Cars from VIN WF0WXXGCEWHE77742 have a standard-fit autonomous emergency braking system. In tests of its functionality at the low speeds at which many whiplash injuries are caused, the system performed adequately.







Restraint for 6 year old child: *Römer KidFix XP* Restraint for 10 year old child: *Graco Booster* **Safety Features**

2 Pts

7.3 Pts

	Front Passenger	2nd row outboard	2nd row center	3rd row outboard *
Isofix	×	٠	×	×
i-Size	×	٠	×	×
Integrated CRS	×	×	×	×

* Third row seats available as option

Fitted to test car as standard O Not on test car but available as option X Not available

CRS Installation Check

Install without problem
Install with care
Safety critical problem
Installation not allowed



<u></u> CHILD OCCUPANT

Total 29.6 Pts / 60%

ISOFIX CRS



Römer KidFix XP (ISOFIX)



Universal Belted CRS

Maxi Cosi Cabriofix (Belt)



Römer KidFix XP (Belt)




Maxi Cosi Cabriofix & EasyBase2 (Belt)

Römer King II LS (Belt)



BeSafe iZi Kid X4 ISOfix (ISOFIX)



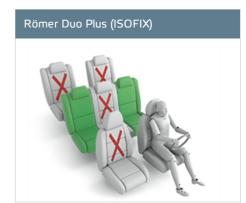



💪 CHILD OCCUPANT

Total 29.6 Pts / 60%


		Seat Position				
	Front	2nd row		3rd row		
	PASSENGER	LEFT	CENTER	RIGHT	LEFT	RIGH
Maxi Cosi 2way Pearl & 2wayFix (rearward) (iSize)		•		•		
Maxi Cosi 2way Pearl & 2wayFix (forward) (iSize)		•		•		
BeSafe iZi Kid X2 i-Size (iSize)		•		•		
Maxi Cosi Cabriofix & FamilyFix (ISOFIX)		•		•		
BeSafe iZ Kid X4 ISOfix (ISOFIX)		•		•		
Römer Duo Plus (ISOFIX)				•		
Römer KidFix XP (ISOFIX)				•		
Maxi Cosi Cabriofix (Belt)	•		•	•		
Maxi Cosi Cabriofix & EasyBase2 (Belt)	•		•	•		
Römer King II LS (Belt)	•	•	•	•	•	•
Römer KidFix XP (Belt)	•					

Comments

In the frontal offset test, readings of neck tension indicated poor protection of this part of the body for the 10-year dummy and marginal protection for the 6-year dummy. In the side barrier test, protection of all critical body areas was good. The front passenger airbag can be disabled in cars fitted with an optional cut-off switch, to allow a rearward-facing child restraint to be used in that seating position. As this switch is not standard equipment, no points are awarded in this assessment and the installation check of rearward-facing restraints is deemed a fail. ISOFIX and i-Size compatible anchorages are available only on the second row outboard seats.



0 Pts

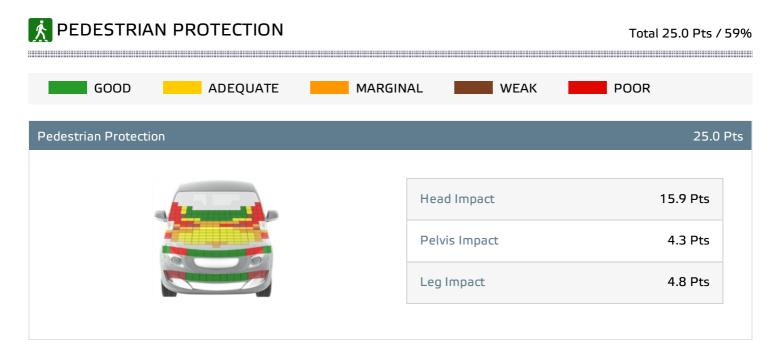

AEB Pedestrian

Comments

The protection provided to the head of a struck pedestrian was predominantly adequate or marginal. Protection of pedestrians' legs by the bumper was mostly good but weak in places, and that of the pelvis was also generally good but with some poor results.



Speed Assistance

1.5 Pts

System Name	ASLD (Adjustable Speed Limiting Device)
Speed Limit Information Function	N/A
Warning Function	Manually set
Speed Limitation Function	Manually set (accurate to 5km/h)

Seat Belt Reminder

2 Pts

Applies To	Front seats		
Warning	Driver Seat	front passenger(s)	rear passenger(s)
Visual	•	•	•
Audible	٠	•	•



Not available



SAFETY ASSIST

Total 3.5 Pts / 29%

Comments

The C-MAX has a seatbelt reminder system for the front seats only. It also has, as standard, a driver-set speed limiter.



RATING VALIDITY

Variants of Model Range

Body Type	Engine DrivetrainRating Applies				
			LHD	RHD	
5 door MPV	1.5 diesel	4 x 2	~	\checkmark	
5 door MPV	2.0 diesel	4 x 2	~	\checkmark	
5 door MPV	1.0 petrol	4 x 2	\checkmark	\checkmark	
5 door MPV	1.5 petrol	4 x 2	\checkmark	\checkmark	
5 door MPV	1.6 petrol	4 x 2	~	\checkmark	
Ford Grand C-MAX, 1.5 diesel was tested					

Annual Reviews and Facelifts

Date Event Outcome December 2017 Rating Published

